INSTRUCTIONS

MODEL AV-151C-C FUNCTION GENERATOR

S.N.:

<u>WARRANTY</u>

Avtech Electrosystems Ltd. warrants products of its manufacture to be free from defects in material and workmanship under conditions of normal use. If, within one year after delivery to the original owner, and after prepaid return by the original owner, this Avtech product is found to be defective, Avtech shall at its option repair or replace said defective item. This warranty does not apply to units which have been dissembled, modified or subjected to conditions exceeding the applicable specifications or ratings. This warranty is the extent of the obligation assumed by Avtech with respect to this product and no other warranty or guarantee is either expressed or implied.

TECHNICAL SUPPORT

Phone: 613-226-5772 or 1-800-265-6681 Fax: 613-226-2802 or 1-800-561-1970


E-mail: info@avtechpulse.com World Wide Web: http://www.avtechpulse.com

TABLE OF CONTENTS

WARRANTY2
TABLE OF CONTENTS4
FIG. 1: BASIC TEST ARRANGEMENT5
GENERAL OPERATING INSTRUCTIONS6
FIG. 2: FRONT PANEL CONTROLS8
FRONT PANEL CONTROLS9
FIG. 3: BACK PANEL CONTROLS11
BACK PANEL CONTROLS12
POWER SUPPLY AND FUSE REPLACEMENT13
PERFORMANCE CHECK SHEET15

Manual Reference: /fileserver1/officefiles/instructword/av-151-153/obsolete/AV151CCeda-fig.doc, created December 21, 1999

FIG. 1: BASIC TEST ARRANGEMENT

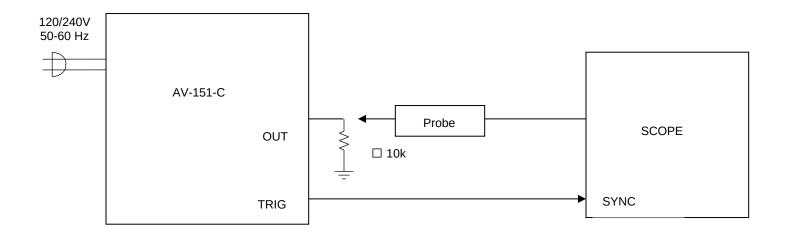

GENERAL OPERATING INSTRUCTIONS

- 1) Connect the instrument as shown above. Do not apply prime power.
- 2) Terminate OUT in a load impedance of 10K (or higher).
- 3) Set the amplitude control to maximum counter clockwise.
- 4) Set the offset control at 5.0 and the offset ON-OFF switch in the OFF position.
- 5) Set the INT-EXT switch in the INT position and the WAVEFORM selector switch in the SINE position.
- 6) Set the PRF range switch in the 10 kHz position (mid range).
- 7) Set the scope time base on about 50 us/div and the vertical on about 50 Volts/div and set the scope time base to trigger on EXT (+).
- 8) Turn on the prime power and adjust scope trigger controls to obtain a trace.
- 9) Rotate the amplitude control clockwise to obtain the desired output amplitude (as high as 200 Volts peak to peak).
- 10) Set the OFFSET ON-OFF switch in the ON position and rotate the OFFSET amplitude control to obtain the desired offset (0 to \pm 25 Volts).
- 11) <u>CAUTION</u>: Take great care not to operate into a low impedance (i.e. < 10K) or into a short circuit as this may result in damage to the output stage.
- 12) Units with a serial number higher than 5600 are protected by an automatic overload protective circuit which controls the front panel overload light. If the unit is overloaded (by operating at an exceedingly high duty cycle or by operating into a short circuit), the protective circuit will turn the output of the instrument OFF and turn the indicator light ON. The light will stay ON (i.e. output OFF) for about 5 seconds after which the instrument will attempt to turn ON (i.e. light OFF) for about 1 second. If the overload condition persists, the instrument will turn OFF again (i.e. light ON) for another 5 seconds. If the overload condition has been removed, the instrument will turn on and resume normal operation. Overload conditions may be removed by:

- 1) Removing output load short circuit (if any)
- 2) Reducing the output amplitude
- 13) To trigger the unit externally, set the INT-EXT switch in the EXT position and apply the signal to be amplified to the TRIG port (Vpp \leq 4 Volts, DC to 50 kHz). The AV-151C-C unit then operates as a variable gain amplifier with a maximum gain of x50 and a maximum output of \pm 100 Volts.
- 14) The unit can be converted from 120 to 240V 50-60 Hz operation by adjusting the voltage selector card in the rear panel fused voltage selector-cable connector assembly.
- 15) For additional assistance:

Tel: (613) 226-5772 Fax: (613) 226-2802 Email: info@avtechpulse.com

FIG. 2: FRONT PANEL CONTROLS

FRONT PANEL CONTROLS

- (1) <u>ON-OFF Switch</u>. Applies prime power to all stages.
- (2) <u>PRF Control</u>. Varies output PRF as follows:

Range 1	5 Hz	50 Hz
Range 2	50 Hz	0.5 kHz
Range 3	0.5 kHz	5 kHz
Range 4	5 kHz	50 kHz


- (3) <u>WAVEFORM</u>. 3-position switch selects between square, sine or triangular output at (4).
- (4) <u>OUT</u>. BNC connector provides output to high impedance load (\geq 10K). Output may include 5 Hz to 50 kHz component and DC offset component.
- (5) <u>AMPLITUDE</u>. Ten turn control determines amplitude of 5 Hz to 50 kHz component at (4).
- (6) <u>OFFSET</u>. Ten turn control allows DC offset at (4) to be varied from 0 to ± 25 Volts. ON-OFF switch turns DC offset on or off.
- (7) <u>INT-EXT, TRIG</u>. With this two position switch in the
- (8) INT position, the frequency and shape of the 5 Hz to 50 kHz component at (4) is determined by controls (2) and (3). Also, in this position a 5 Volt square wave is provided at (8) for the purpose of triggering a scope. When the two position switch is in the EXT position, the AV-151-C may be used as a DC-50 kHz variable gain (x50 max) amplifier. The required input signal is applied at (8) for this mode of operation (□ 2 Volts max).

(9) <u>OVERLOAD</u>. Units with a serial number higher than 5600 are protected by an automatic overload protective circuit which controls the front panel overload light.

If the unit is overloaded (by operating at an exceedingly high duty cycle or by operating into a short circuit), the protective circuit will turn the output of the instrument OFF and turn the indicator light ON. The light will stay ON (i.e. output OFF) for about 5 seconds after which the instrument will attempt to turn ON (i.e. light OFF) for about 1 second. If the overload condition persists, the instrument will turn OFF again (i.e. light ON) for another 5 seconds. If the overload condition has been removed, the instrument will turn on and resume normal operation. Overload conditions may be removed by:

- 1) Removing output load short circuit (if any)
- 2) Reducing the output amplitude

FIG. 3: BACK PANEL CONTROLS

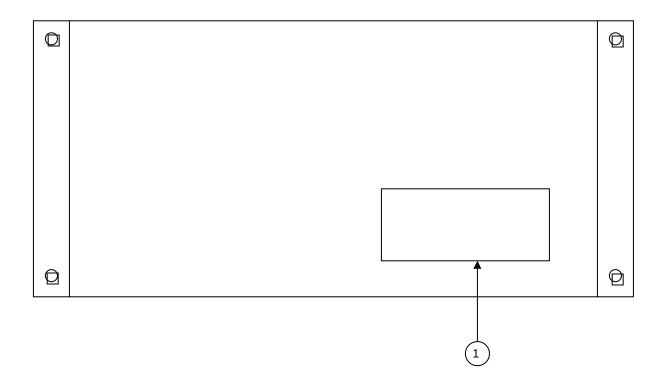

BACK PANEL CONTROLS

1) <u>FUSED CONNECTOR, VOLTAGE SELECTOR</u>. The detachable power cord is connected at this point. In addition, the removable cord is adjusted to select the desired input operating voltage. The unit also contains the main power fuse.

For AC line voltages of 110-120V, the power selector card should be installed so that the "120" marking is visible from the rear of the instrument.


For AC line voltages of 220-240V, the power selector card should be installed so that the "240" marking is visible from the rear of the instrument.

If it is not set for the proper voltage, remove the fuse and then grasp the card with a pair of pliers and remove it. Rotate horizontally through 180 degrees. Reinstall the card and the correct fuse.

In the 120V setting, a 0.5A slow blow fuse is required. In the 240V setting, a 0.25A slow blow fuse is required.

This instrument has three fuses (plus one spare). One, which protects the AC input, is located in the rear-panel power entry module, as described in the "Rear Panel Controls" section of this manual. If the power appears to have failed, check the AC fuse first.

The other two fuses (plus one spare) are located on the internal DC power supply, as shown below:

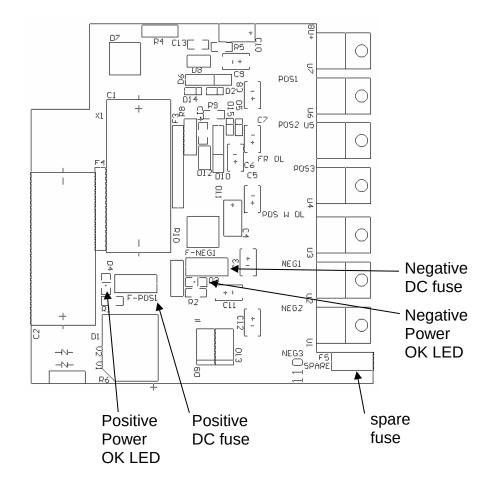

The positive fuse and the spare fuse on this circuit board are 1A slow-blow fuses, Littlefuse part number R452001. (This fuse can be ordered from Digikey, www.digikey.com. The Digikey part number is F1343CT-ND). The negative fuse is a 0.5A slow-blow fuse (Littlefuse R452.500, Digikey part number F1341CT-ND).

If you suspect that the DC fuses are blown, follow this procedure:

- 1. Remove the top cover, by removing the four Phillips screws on the top cover and then sliding the cover back and off.
- 2. Locate the two "Power OK" LEDs on the power supply circuit board, as illustrated above.
- 3. Turn on the instrument.
- 4. Observe the "Power OK" LEDs. If the fuses are not blown, the two LEDs will be lit (bright red). If one of the LEDs is not lit, the fuse next to it has blown.
- 5. Turn off the instrument.
- 6. If a fuse is blown, use needle-nose pliers to remove the blown fuse from its surface-mount holder.
- 7. Replace the fuse.

PERFORMANCE CHECK SHEET